



Machined welding fixtures made of ductile cast iron.

- Superb Weld Joint Access on all sides.
- Quick Acting Button for fast adjustment (except Model WAC22 and WAC34).
- Copper Plated Spindle Resists Weld Spatter.

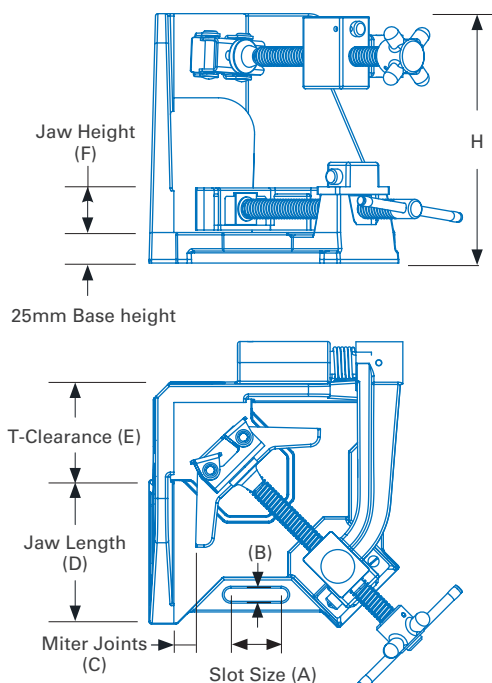

2 Magnetic Rest Blocks (included except models: WAC22 and WAC434) to support and level long stock!

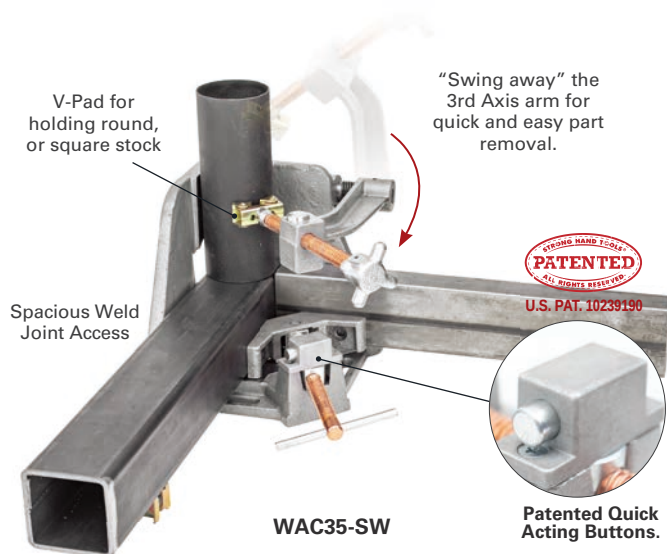

2 Stand-off Bolts (included in all models) for use with angle iron



Pivoting Head



Angle Iron with Stand Off Feature



T-Joints



Machined Outside Faces for upright joint.



PN	2-Axis Vises Features				A	B	C	D	E	F	Weight
	Quick Acting Button	2x Stand-offs	2x Magnetic Rest Blocks	Machined on Outside Faces	(mm)	(mm)	(mm)	(mm)	(mm)	(mm)	(kg)
WAC22		✓		✓	35.5	11	63.5	80	47	33	2.8
WAC34		✓			40	11	95	107	64	35	4.3
WAC35D	✓	✓	✓	✓	40	11	95	107	64	35	4.5
WAC45	✓	✓	✓	✓	51	11	125	135	103	64	10.0



3-Axis Vises Features:

- 2 Quick Acting Buttons
- 2 Stand-off Bolts
- Swing-away Arms
- 2 Magnetic Rest Buttons

PN	A (mm)	B (mm)	C (mm)	D (mm)	E (mm)	F (mm)	H (mm)	Weight (kg)
WAC35-SW	42	11	95	120	64	36	210	11
WAC45-SW	51	11	125	135	103	64	245	16